Silchester Garages Tree Survey January 2011

Tree No	Species	Ht m	Ag e	Physiologi cal Condition	Structural Condition and Comments	Recommendations	Estimated Remaining Contribution (years)	BS5837 category
1	Hornbeam Carpinus betulus 'Fastigiata'	12	MA	Good	Good	None	40	A2
2	False Acacia Robinia pseudoacacia	9	M	Fair	Fair. Possible decay at base	Monitor	10-20	C2
3	Whitebeam Sorbus aria	7	MA	Good	Good	None	20-40	B2
4	Norway maple Acer platanoides	8	MA	Good	Good	None	20-40	B2
5	Caucasian Lime Tilia euchlora	13	M	Good	Good. Hanging broken branch	Crown Clean	40+	A2
6	False Acacia Robinia pseudoacacia	10	М	Fair	Fair. Minor dead wood	Crown Clean	20-40	B2
7	Whitebeam Sorbus aria	9	М	Fair	Fair. Previously crown reduced	Crown Clean	10-20	C2
8	Caucasian Lime Tilia euchlora	15	М	Good	Fair. A little over-thinned.	Remove lowest 2 branches	20-40	B2
9	Whitebeam Sorbus aria	9	MA	Good	Good. A little suppressed by adjacent lime	None	20-40	B2
10	Italian alder Alnus cordata	20	М	Good	Good. Leans somewhat	Crown Clean	20-40	B2
11	Multi-stemmed Himalayan Birch Betula jacquemontii	6	Y	Good	Good. Low categorisation due to ease of replacement	None	20-40	C2

Note: The survey was carried out using the guidelines in *British Standard 5837: 2005 - Trees in Relation to Construction Recommendation*, although some detail was omitted namely: trunk diameter, crown height and branch spread.

Key:

Height: Ht – in metres (estimated)

Age: Y= Young, MA = Middle Aged, M = Mature, OM = Over Mature, V= Veteran

n/w – no work

An explanation of the BS5837 categories is provided on the attached sheet.

